


# 2007 Ninja® ZX™-14

## PARTS DIAGRAM

### Transmission

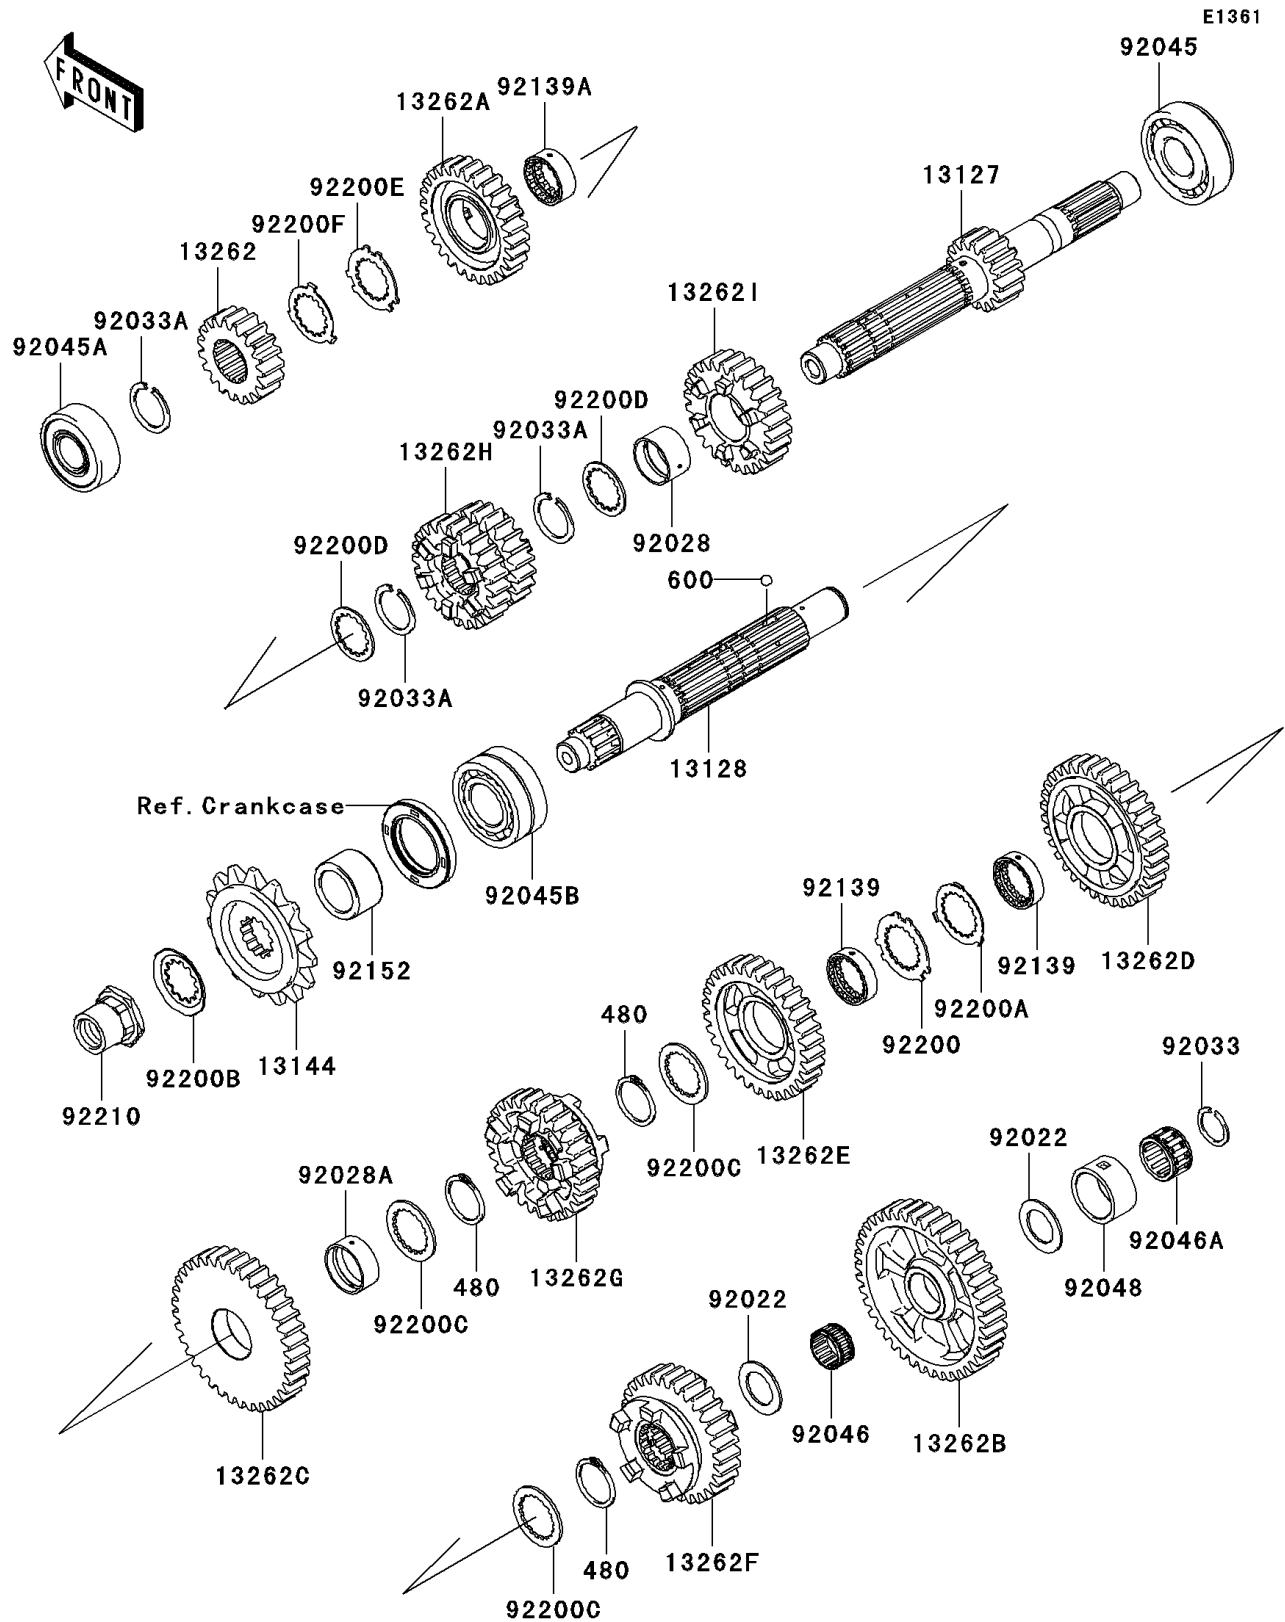

# 2007 Ninja® ZX™-14

## PARTS LIST

### Transmission

ITEM NAME	PART NUMBER	QUANTITY
SHAFT-TRANSMISSION INPUT,16T (Ref # 13127)	13127-0036	1
SHAFT-TRANSMISSION OUTPUT (Ref # 13128)	13128-0035	1
SPROCKET-OUTPUT,17T (Ref # 13144)	13144-0040	1
GEAR,INPUT 2ND,19T (Ref # 13262)	13262-0303	1
GEAR,INPUT TOP,28T (Ref # 13262A)	13262-0306	1
GEAR,OUTPUT LOW,42T (Ref # 13262B)	13262-0307	1
GEAR,OUTPUT 2ND,37T (Ref # 13262C)	13262-0308	1
GEAR,OUTPUT 3RD,34T (Ref # 13262D)	13262-0309	1
GEAR,OUTPUT 4TH,32T (Ref # 13262E)	13262-0310	1
GEAR,OUTPUT 5TH,30T (Ref # 13262F)	13262-0311	1
GEAR,OUTPUT TOP,29T (Ref # 13262G)	13262-0312	1
GEAR,INPUT 3RD&4TH,22T&24T (Ref # 13262H)	13262-0417	1
GEAR,INPUT 5TH,26T (Ref # 13262I)	13262-0421	1
CIRCLIP (Ref # 480)	480J2900	3
"BALL-STEEL,5/32",,2017-03-16 13:30 (Ref # 600)	600A0500	3
WASHER,22.3X35X1.6 (Ref # 92022)	92022-212	2
BUSHING (Ref # 92028)	92028-1935	1
BUSHING (Ref # 92028A)	92028-1937	1
RING-SNAP,20X25.5X1.2 (Ref # 92033)	92033-025	1
RING-SNAP,T=1.5 (Ref # 92033A)	92033-1249	3
BEARING-BALL,830045-5SH2 (Ref # 92045)	92045-0047	1
BEARING-BALL,DG2152RDDSH2 (Ref # 92045A)	92045-0048	1
BEARING-BALL,DAC2857NSSH6CS9 (Ref # 92045B)	92045-0049	1
BEARING-NEEDLE,K22X26X13 (Ref # 92046)	92046-0018	1
BEARING-NEEDLE,K22X30X16.8X2 (Ref # 92046A)	92046-1268	1
RACE (Ref # 92048)	92048-0004	1
BUSHING,GEAR,3RD&4TH OUT (Ref # 92139)	92139-0127	2
BUSHING,GEAR,6TH IN (Ref # 92139A)	92139-0128	1
COLLAR (Ref # 92152)	92152-0326	1

# 2007 Ninja<sup>®</sup> ZX<sup>™</sup>-14

## PARTS LIST

### Transmission

ITEM NAME	PART NUMBER	QUANTITY
WASHER,27.5X43X1.5 (Ref # 92200)	92200-0255	1
WASHER,27.5X39.7X1.0 (Ref # 92200A)	92200-0256	1
WASHER,23.9X45X1.0 (Ref # 92200B)	92200-0260	1
WASHER,TOOTHED,28X40X2 (Ref # 92200C)	92200-1277	3
WASHER,25.5X35.5X1.5 (Ref # 92200D)	92200-1340	2
WASHER,25.8X40.5X1.5 (Ref # 92200E)	92200-1522	1
WASHER,25.2X37.0X1.0 (Ref # 92200F)	92200-1523	1
NUT,20X1.5 (Ref # 92210)	92210-0237	1